



1034906881

10: 88063840

QL
84.2
L35



88063840

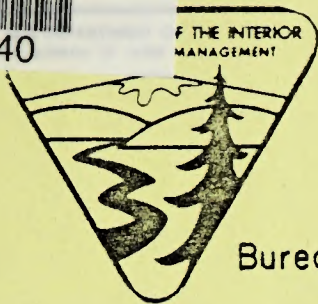

TECHNICAL NOTE

Filing Code 1525 (P-401) no.32


Date Issued May 1970

Bureau of Land Management U.S. DEPARTMENT OF THE INTERIOR

CHEVROLET VEHICLES EQUIPPED WITH ROCHESTER CARBURETORS

We have been advised that several 1968 and 1969 Chevrolet engines equipped with a Rochester Monojet Carburetor have been damaged, due to air cleaner stud bracket screws vibrating loose and dropping into the combustion chamber. This has caused broken cylinder heads, pistons, and cylinder wall damage.

To correct the problem, remove the bracket screws and place an internal Star Lock Washer, Size No. 10, under each screw and tighten securely.

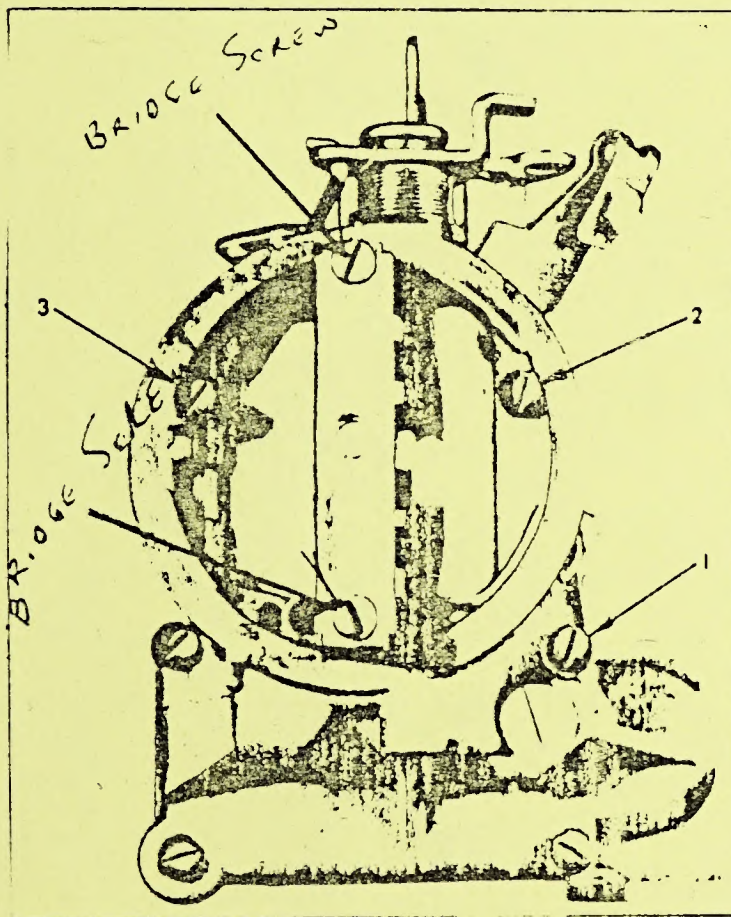

FOR ADDITIONAL COPIES WRITE TO DIRECTOR, PORTLAND SERVICE CENTER, BOX 3861, PORTLAND, ORE., 97208

